



Новости

Ремонт

Тюнинг

Руководства

Разное

Ссылки

О себе

Rear Window Washer Repair Ford Galaxy

Cars of concern VAG is pure VW Sharan, SEAT Alhambra and FORD Galaxy have the second-generation rear window washer tube which passes through the axis of the rear window wiper (the wiper). Over time, the tube-axis drive inside dvornnika can oxidize, which causes that the tube, located inside her and which comes Washer zhitkost can jam and broke. As a result, liquid will flow in the opposite direction under the rear side door trim. Washer fluid may enter the control unit rear wiper and disable the electronics unit. The first sign that your windshield wiper problem is rotating together with the janitor pressure washer. So the handset is already broken and in need of repair.




We start with the repair of removing the rear wiper. To do this, remove the decorative cap and carefully unscrew the nut securing the janitor.




Now you need to remove the rear door trim panel. Then you can remove the rear wiper mechanism. To do this, remove from him connectors, tube feeding washer fluid and unscrew the nuts.



Unscrew the lid rear wiper mechanism.

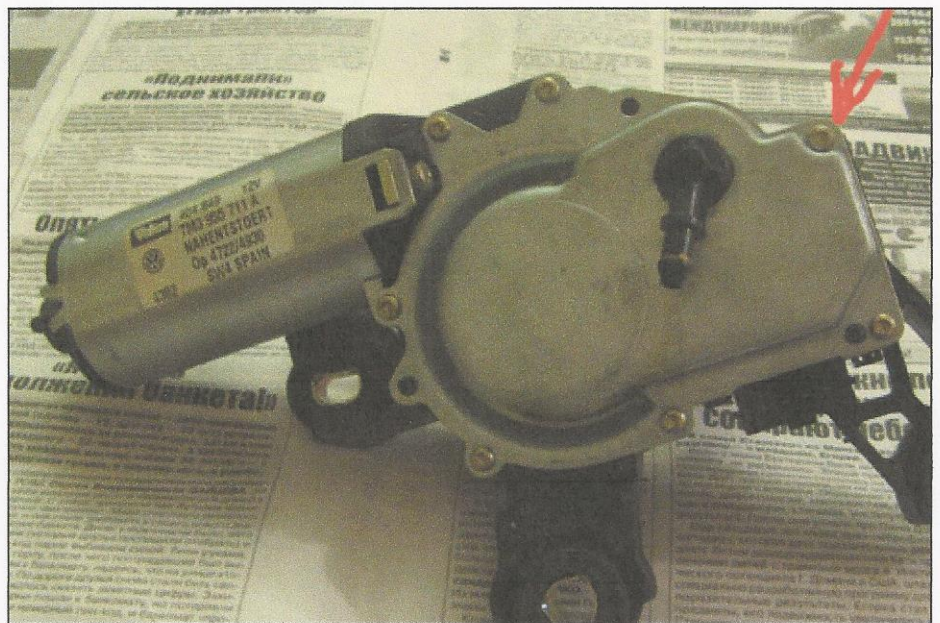


After removing the cover we see a broken pipe supplying water to the sprayer.

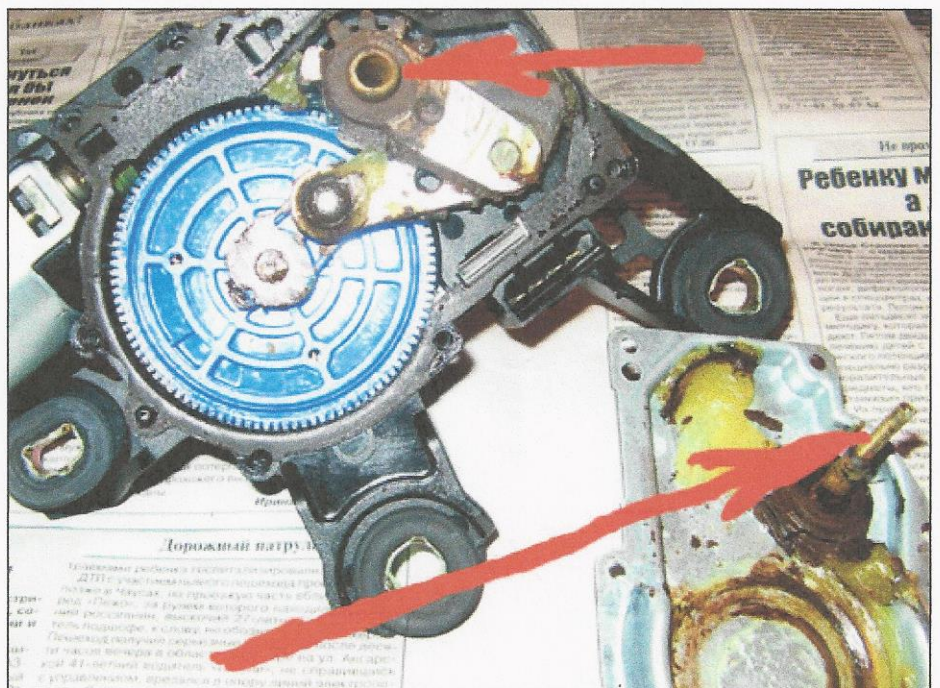

I replaced the broken pipe to a suitable length and diameter copper pipe. collect it in reverse order. At the same time change and a new rear wiper.

lubricate all the gear and

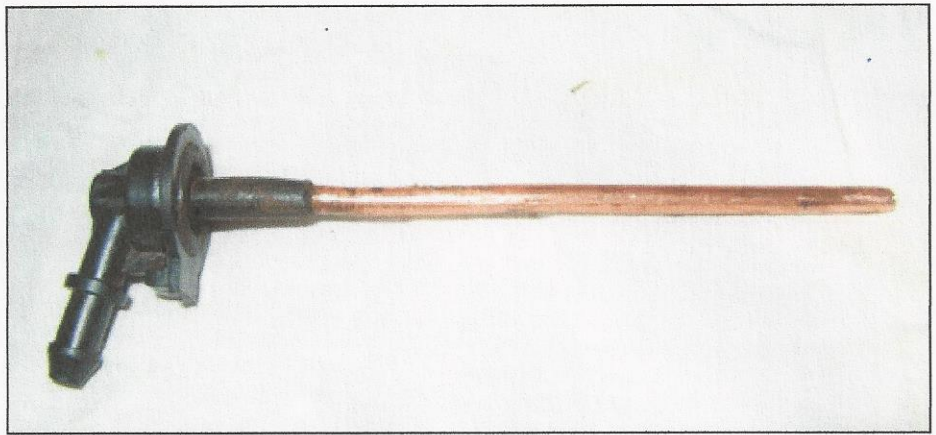

To restore mechanism can be purchased ready-made set, which includes a new tube, gasket and a bag of grease. Its catalog number 7M3998711.

